

Mast: Superspar M7 - R16 Main - Mackay

TIP 1

Mast Rake:

For a correct measurement,
be sure the main sheet line
is in the right position
1) pull the line all the
way to the top of the mast.

2) As a reference, the top of the
black line on the mast (near the boom)
must be 5.75 cm.



3) Check out that the line is
at the correct place every time
you pull it up again.

4) Place tensiometer at the
black mark level.

TIP 2

Shroud tension

Place the tensiometer
as high as possible.

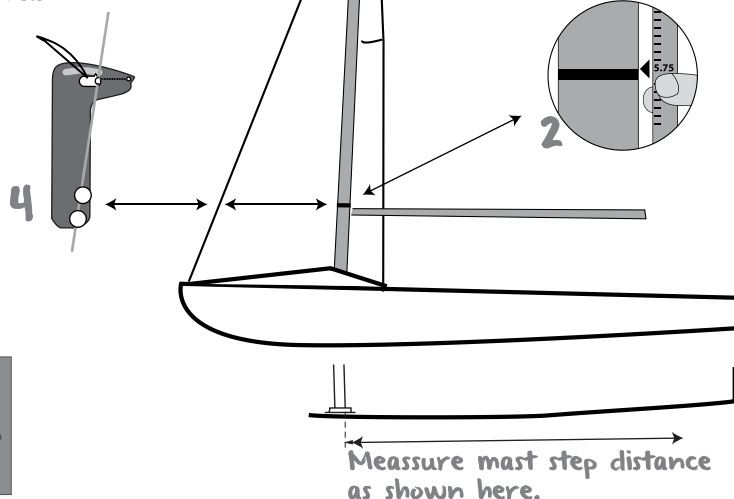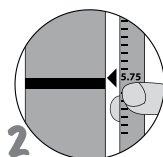

Measure mast step distance
as shown here.





TIP3

Hold mainsheet line as
tight as possible

Measure prebend in (A) from
mast to inner side of the rope

SPREADERS LENGTH

 From shroud center to mast. (B)

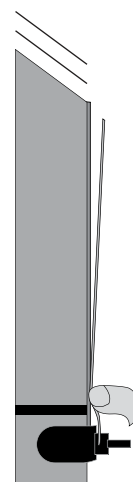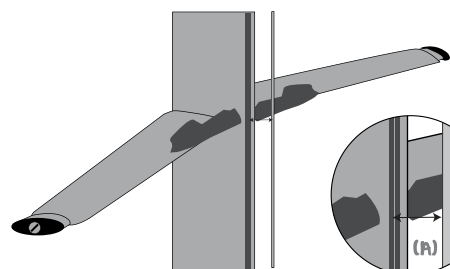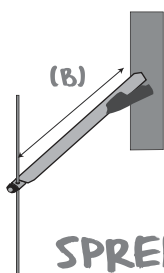

Settings	0-8 kn	9-12 kn	12-14 kn	15-18 kn	19-22 kn	>22 kn
Rake	6.75	6.72	6.68	6.64	6.61	6.58
Prebend	70	62	68	76	87	92
Tension	26	26/27	26/27	26/27	26	26
Mast step	0	1	1	1	1	1
Chocks	-2/1	1-2	1-2	1	0	0
Spreraders leng	475	475	475	475	475	475

NOTES Tension: Use Loose PT-1 - 3mm dyform cable.

Mast step O position: 308cm from the stern until the back pin to the mast

Spreaders rounds + open, - close